


Section: 01	Date: 2017-10-23	Job ID: 1234-5678	Client: MINICAM	Operator: M.STARK
-----------------------	----------------------------	-----------------------------	---------------------------	-----------------------------


Place: GOLBORNE	Direction: Upstream	Start Ref: 0401
Road: MARYFIELD CLOSE	Use: Combined	Start Depth: 1.12m
	Pipe Shape: Circular	End Ref: 9402
	Pipe Material: Concrete	End Depth: 1.09m
	Width / Height: 300mm	

Comments: **WEATHER-LIGHT RAIN**

(0401) 0.80m

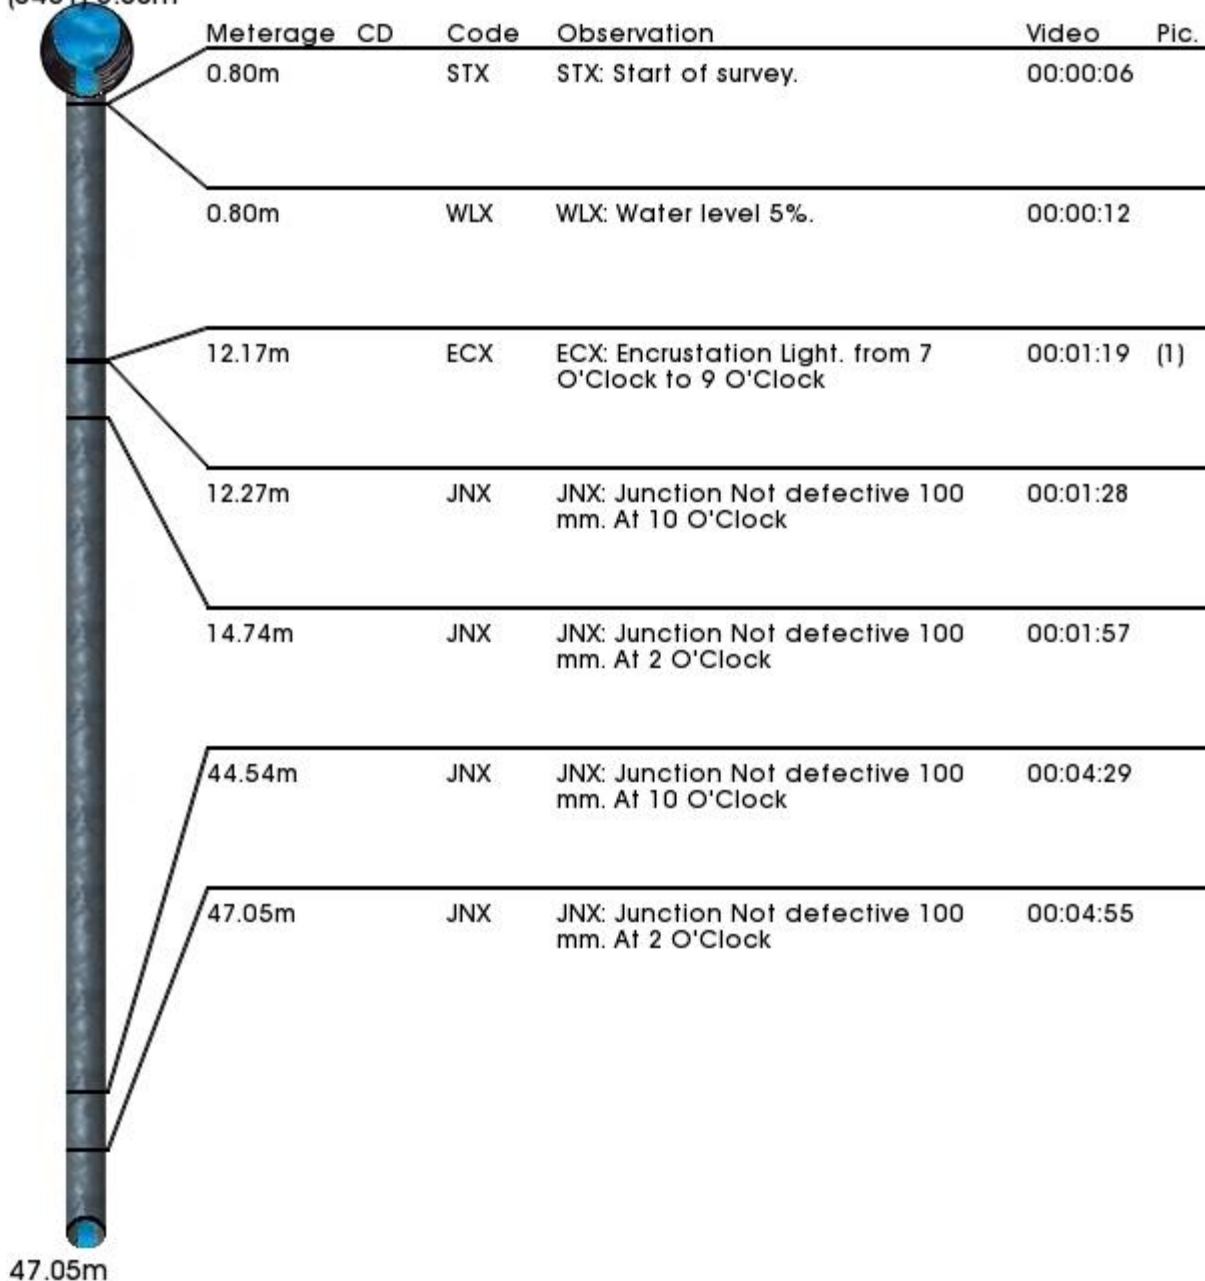

Section: 01	Date: 2017-10-23	Job ID: 1234-5678	Client: MINICAM	Operator: M.STARK
-----------------------	----------------------------	-----------------------------	---------------------------	-----------------------------



Meterage	CD	Code	Observation	Video	Pic.
64.38m		JNX	JNX: Junction Not defective 100 mm. At 10 O'Clock	00:07:31	
66.66m		ECX	ECX: Encrustation Light. from 12 O'Clock to 5 O'Clock	00:07:59	(2)
66.96m		JNX	JNX: Junction Not defective 100 mm. At 2 O'Clock	00:08:15	
72.23m	S1	ECX	ECX: Encrustation Light. from 5 O'Clock to 7 O'Clock S1	00:09:06	(3)
75.35m	F1	ECX	ECX: Encrustation Light. from 5 O'Clock to 7 O'Clock S1	00:10:08	
75.35m		ENX	ENX: End of survey.	00:10:11	

Section: 01	Date: 2017-10-23	Job ID: 1234-5678	Client: MINICAM	Operator: M.STARK
-----------------------	----------------------------	-----------------------------	---------------------------	-----------------------------



(1)



(2)



(3)